

SOUTH BEND TACKLE COMPANY, INC.


SUPPLEMENTAL SERVICE BULLETIN #5-1

March 9, 1964

Subject: Sea-Matic Reel #808

Condition: Under hard surf casting, the inertia of a hard cast may occasionally trip the bail during the cast.

Correction: Install D29 Bail Trip Brake with D32S Bearing Cover Screws.

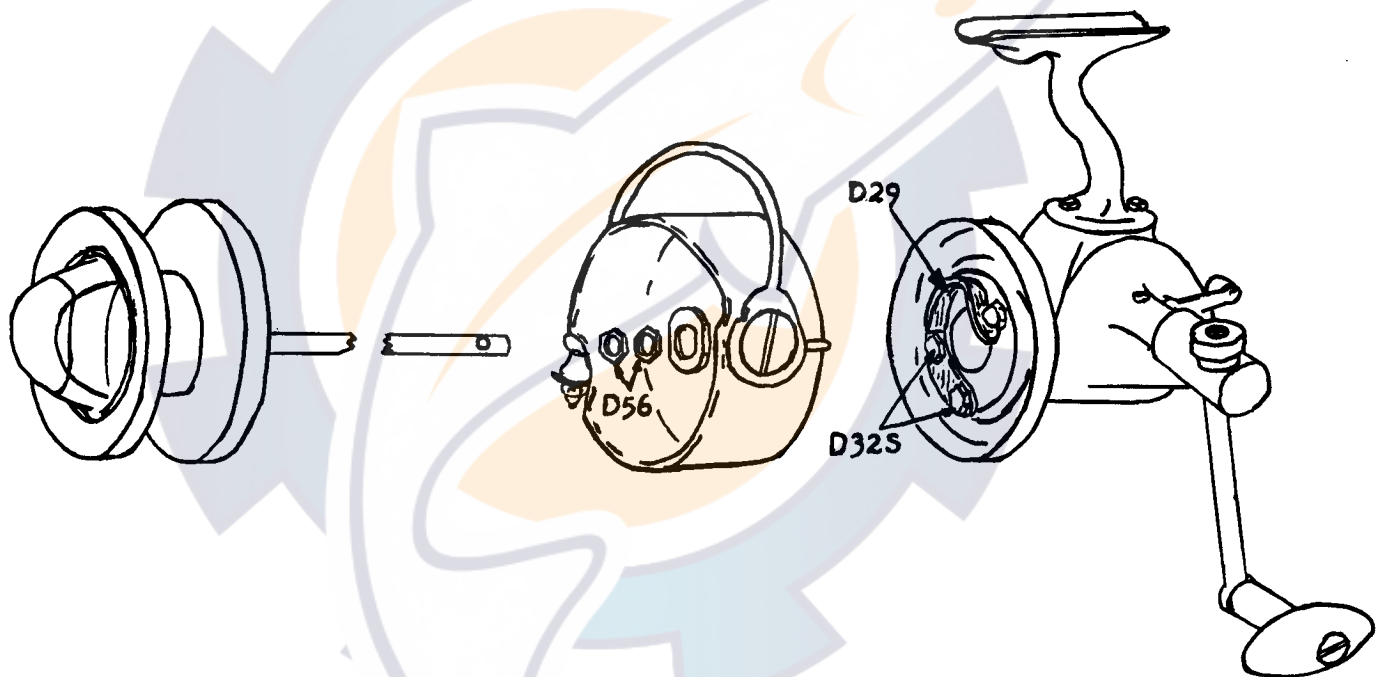

- Procedure:
1. Remove cover plate
  2. Remove level wind yoke screw
  3. Remove spool and main shaft
  4. Remove pickup housing nuts D56 and complete pickup sub assembly.
  5. Remove and destroy bearing cover screws D32S
  6. Install Bail Trip Brake using new bearing cover screws enclosed with Bail Trip Brake.
  7. Re-assemble in reverse order.